



VeriMark Windows 10 Manual Driver Install

Install the driver through Windows 10 Manual driver install


1. On the VeriMark support page, select **VeriMark IT** to go to the setup guides and driver download.

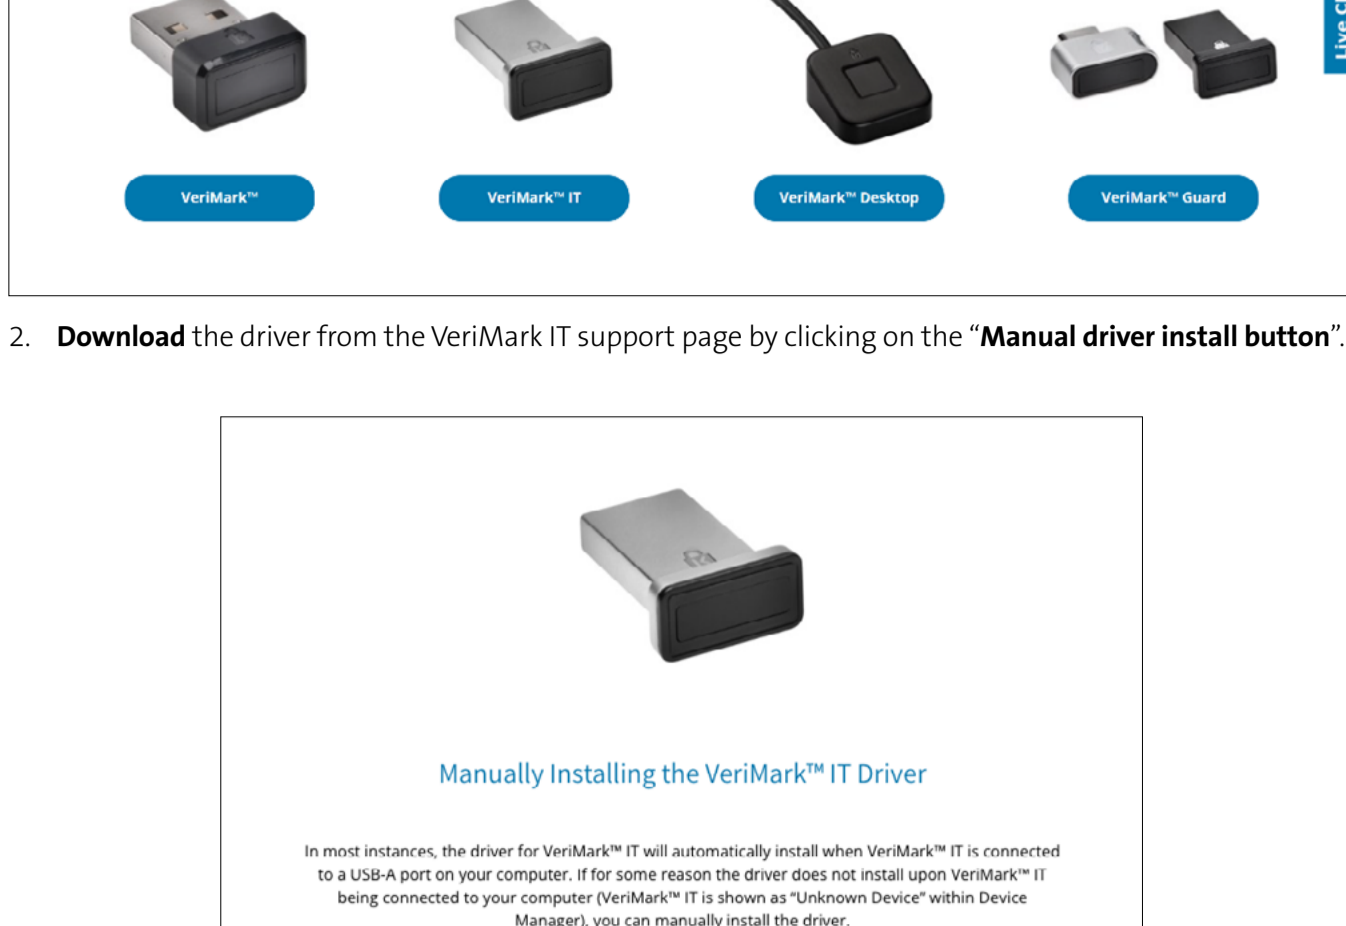


2. Download the driver from the VeriMark IT support page by clicking on the "Manual driver install button".

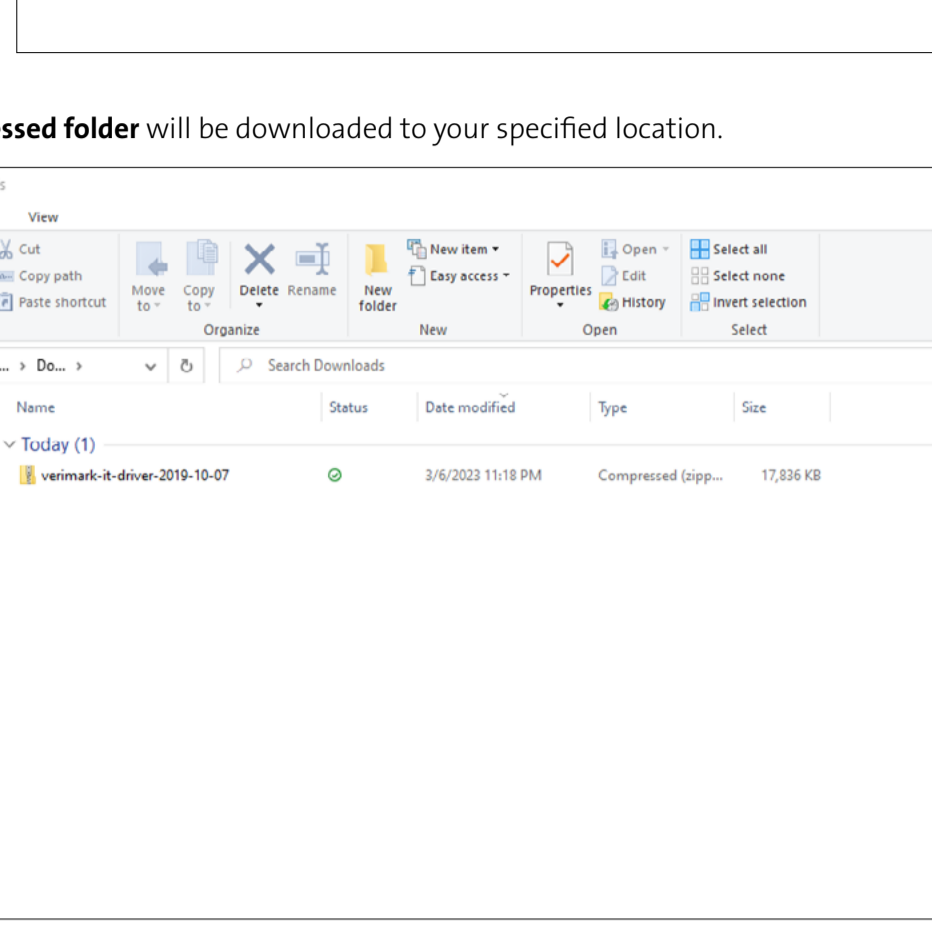


3. The compressed folder will be downloaded to your specified location.

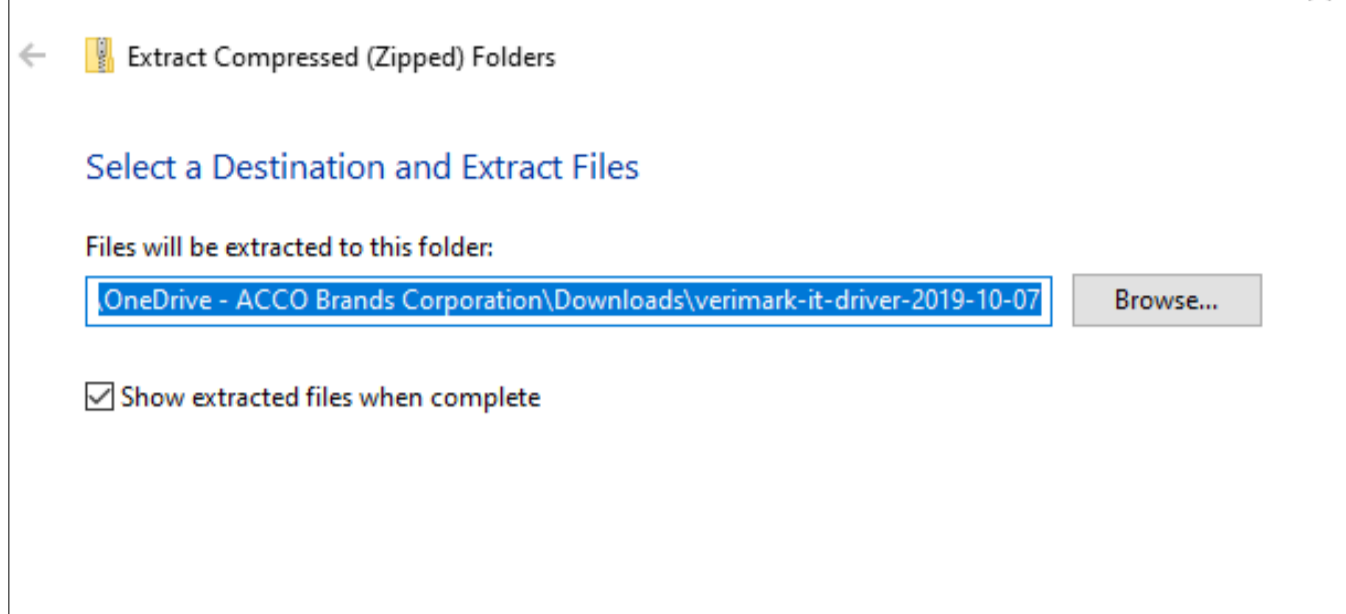

4. Extract the files of the compressed folder to a selected destination.

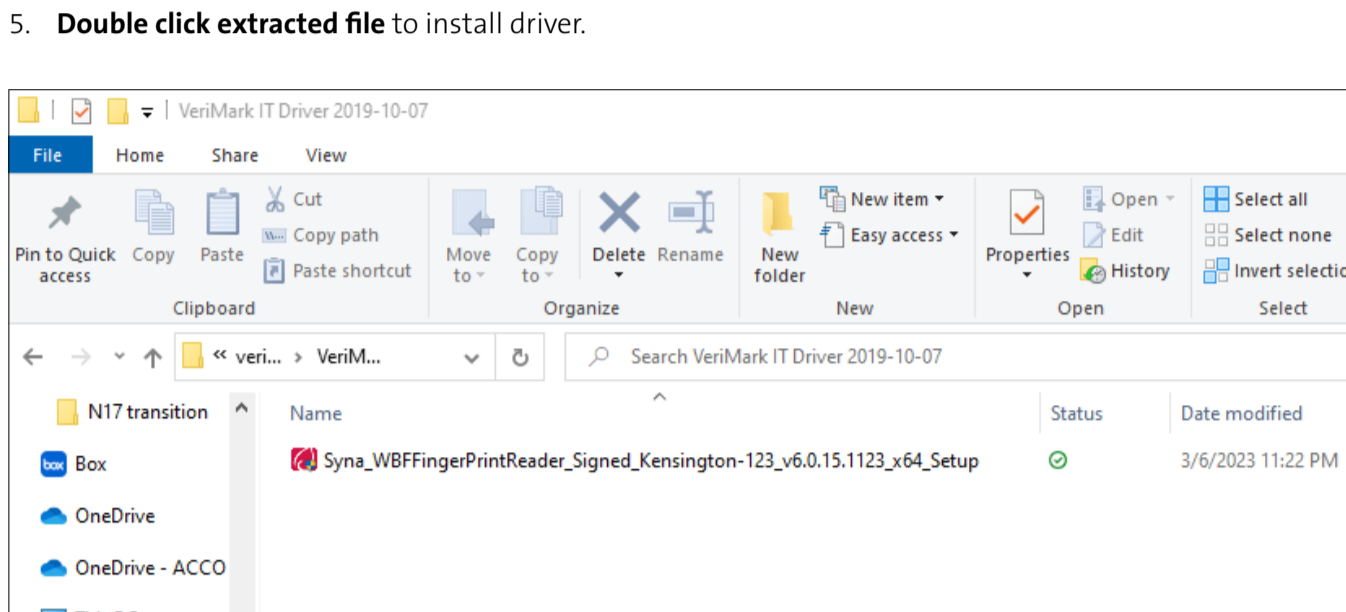

5. Double click extracted file to install driver.

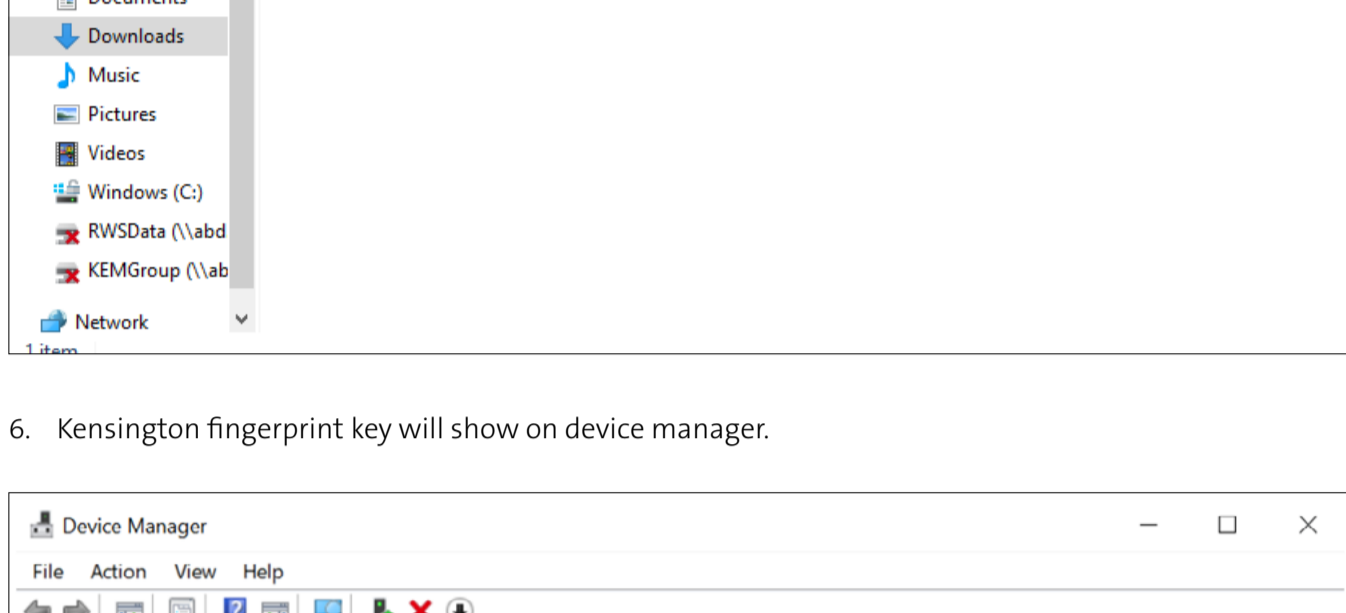


6. Kensington fingerprint key will show on device manager.




VeriMark Windows 10 (Windows Hello) Setup Guide


1. Select and click the **START** icon and select **Settings**.

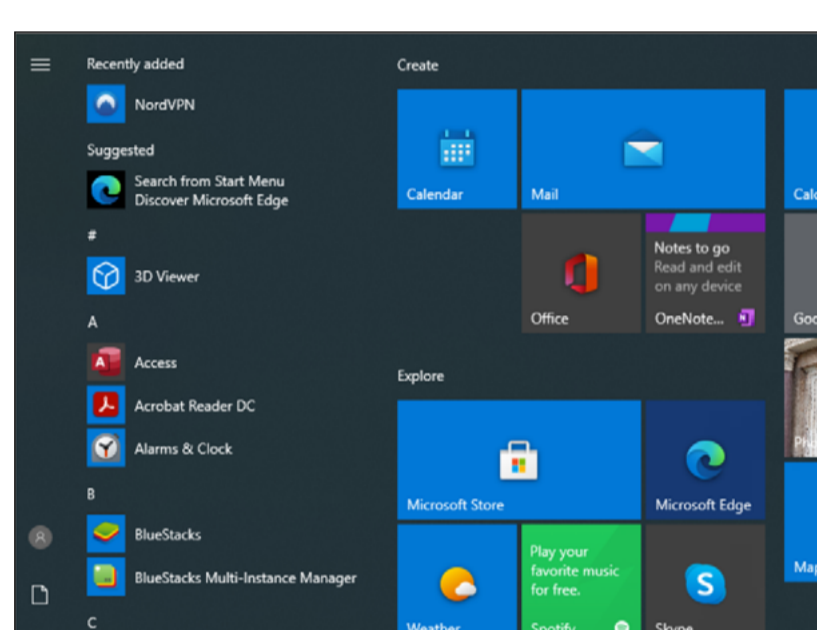


2. Select **Accounts**.

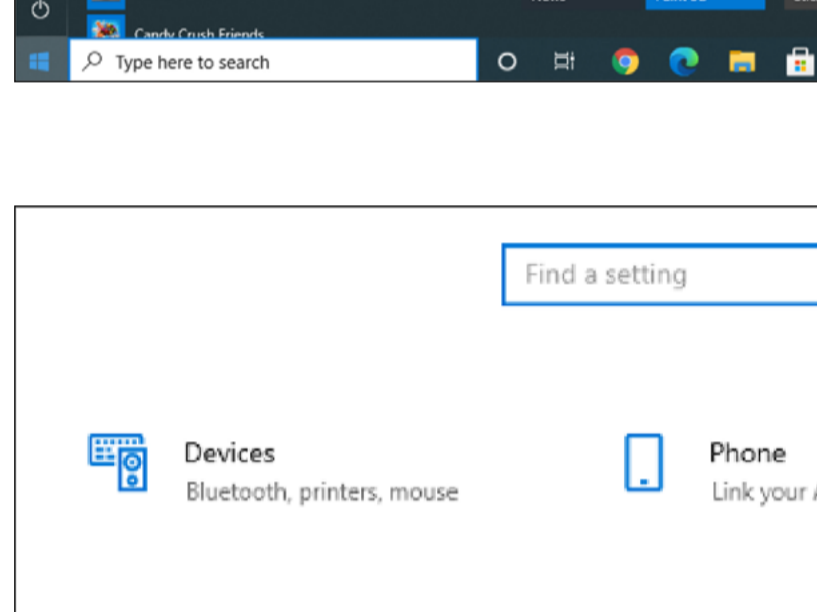


3. Click on the **Sign in options** tab.

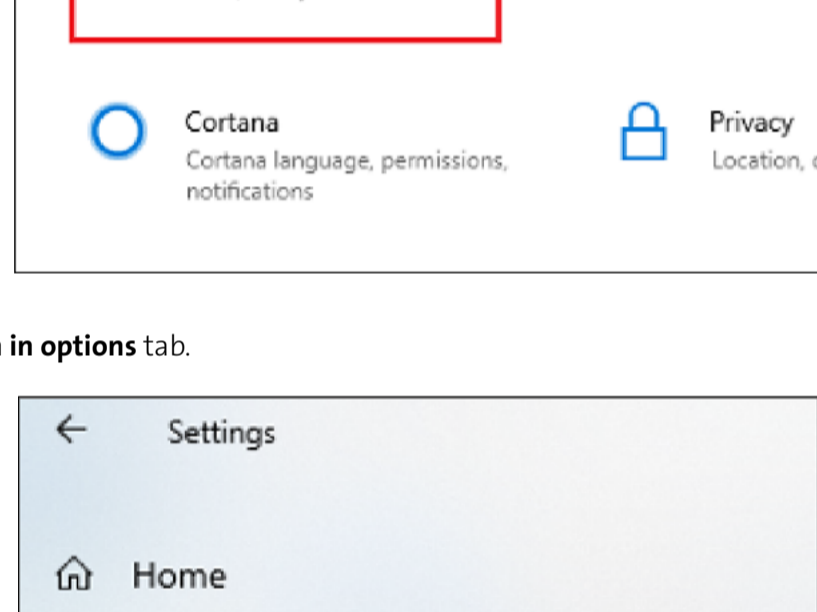


4. Click on the **Windows Hello fingerprint** option.

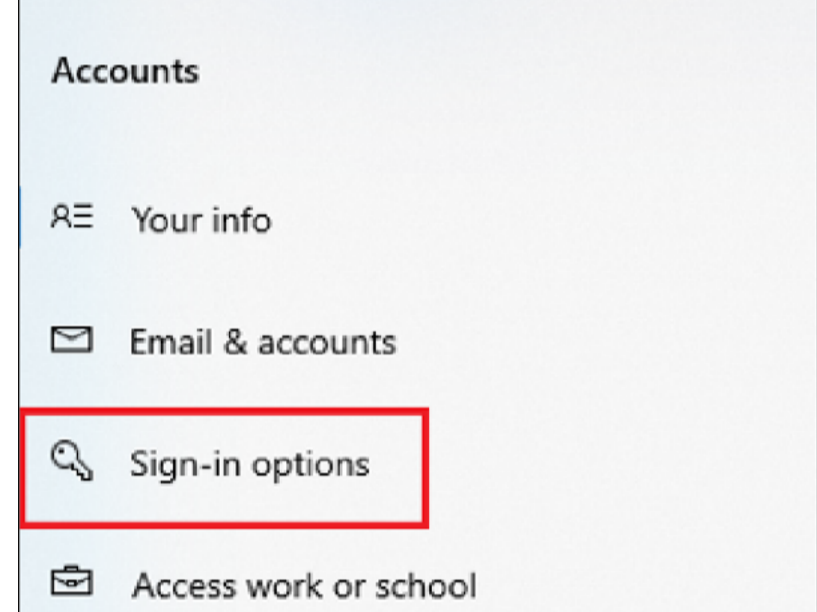


5. Then click **Set up** button.

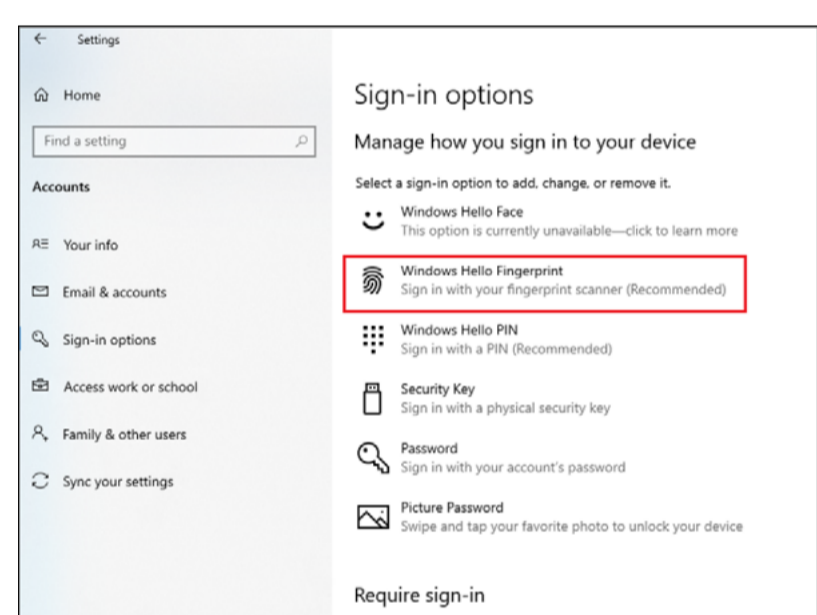


6. Click **Get Started**.

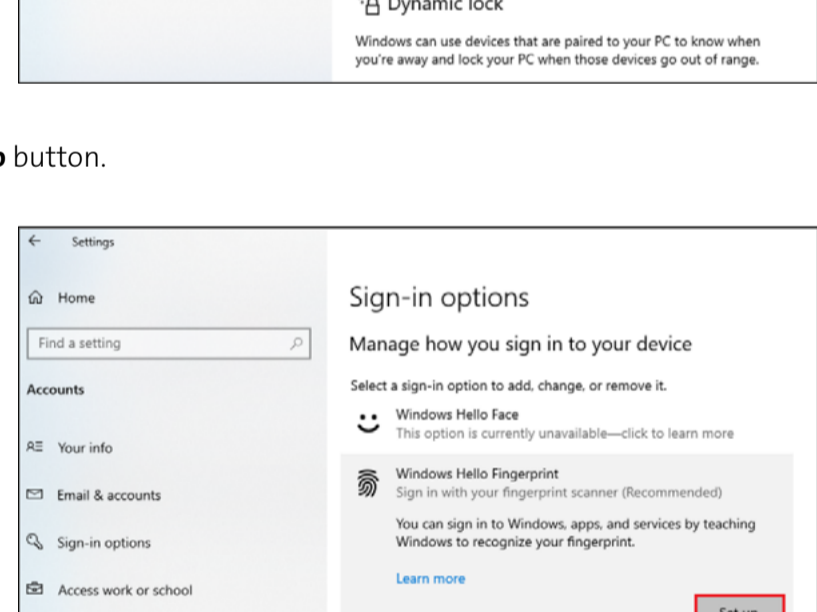


7. Touch the sensor multiple times, follow the scanning instructions.

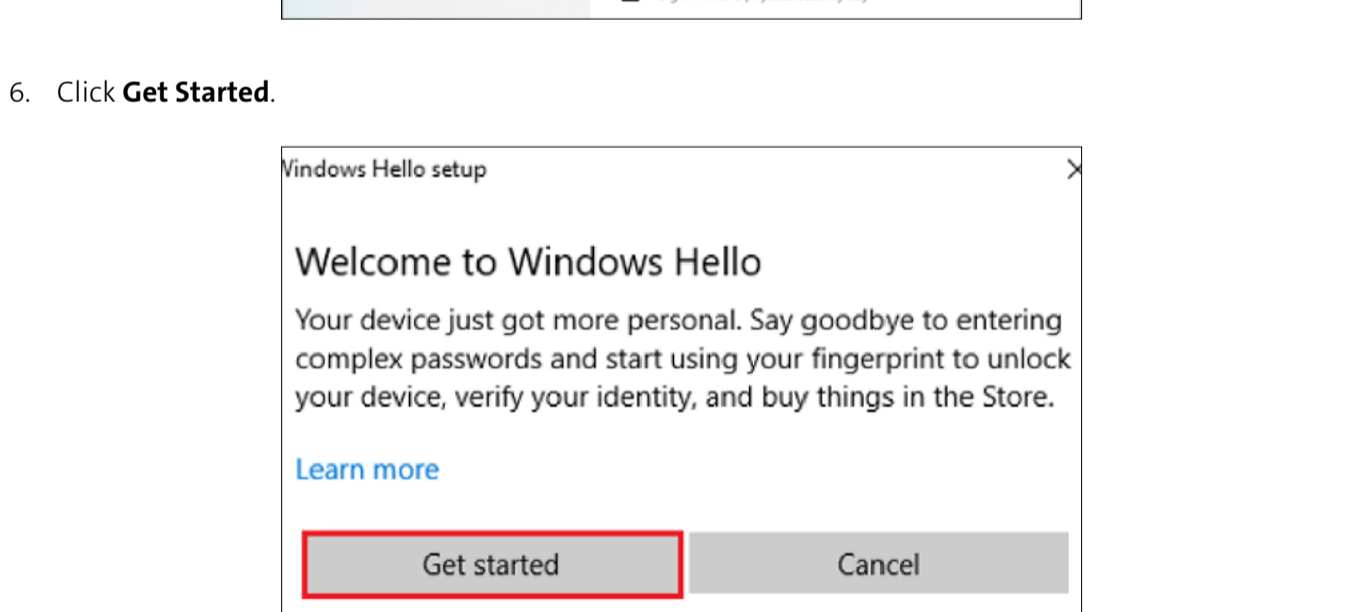


8. When prompted to try another angle click **next** and continue scanning and follow instructions.

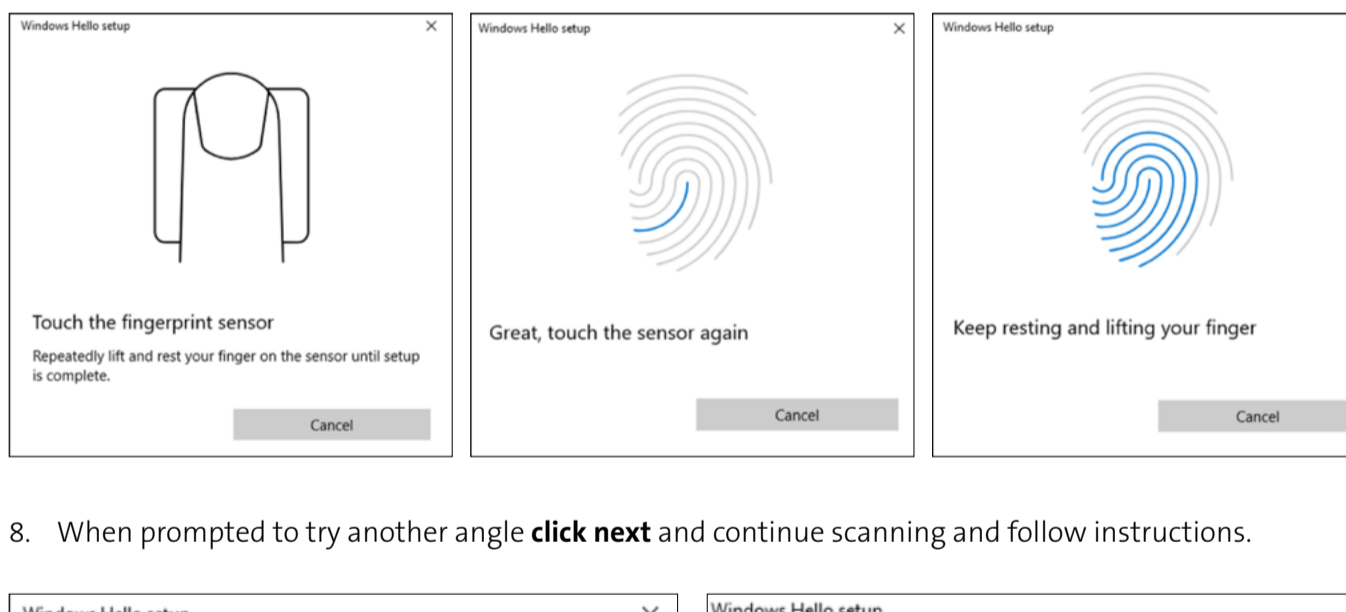


9. Click on **set up PIN**.

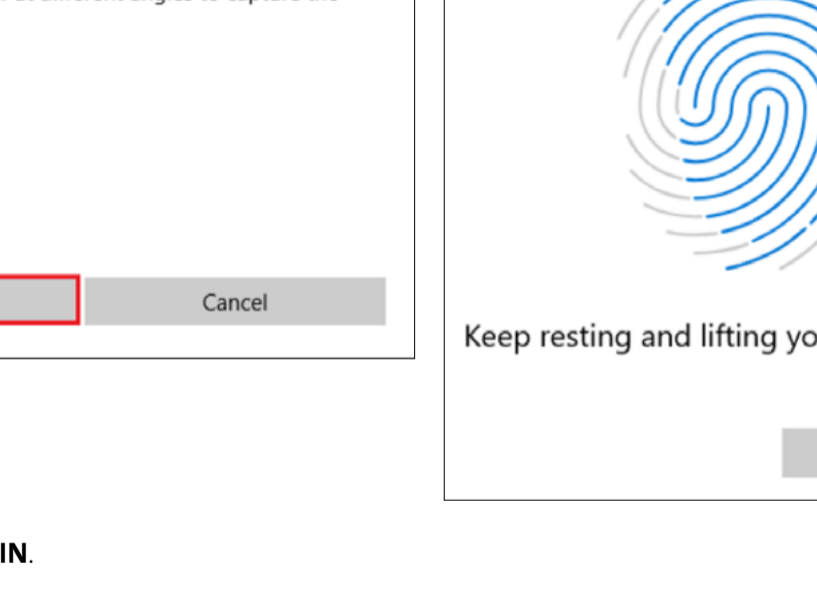


10. **Type** password to verify account and click **OK**.

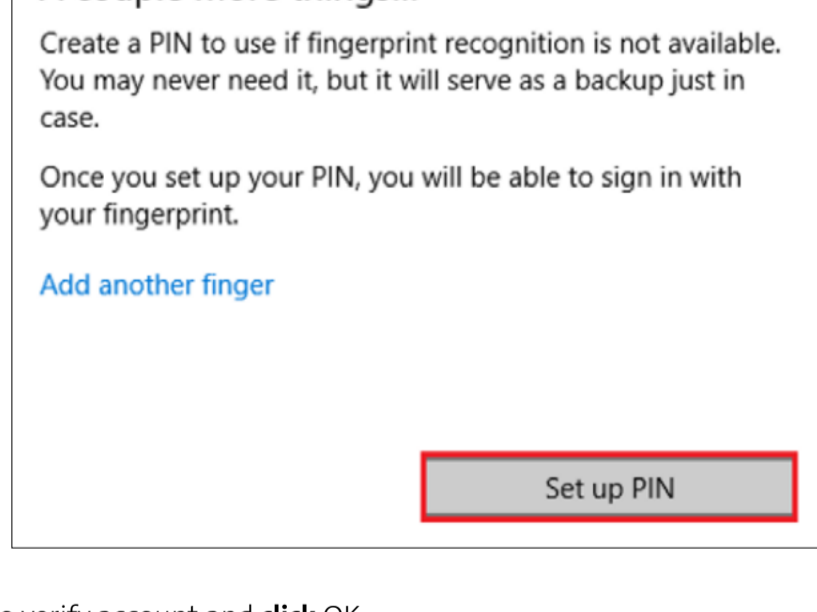

11. Type a PIN and click ok.

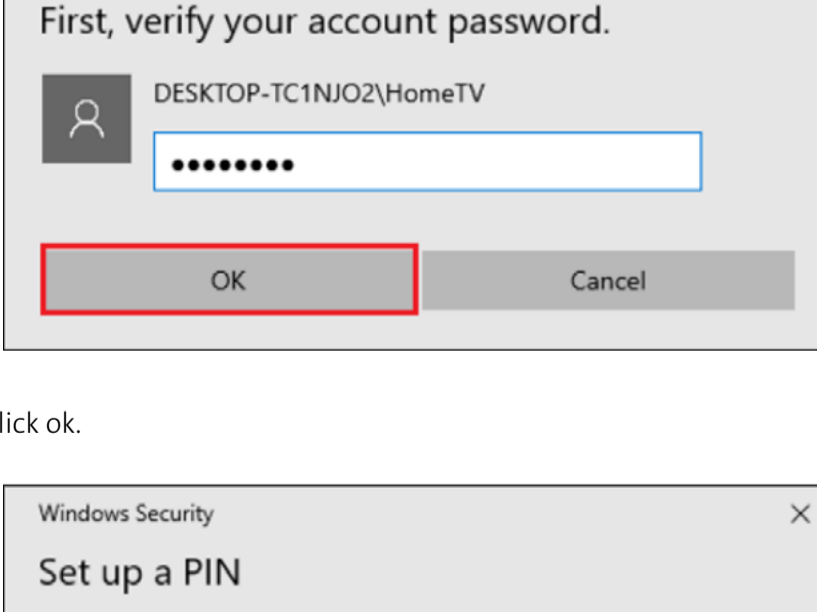

12. If you want the PIN to contain **letters and symbols**, select the option.

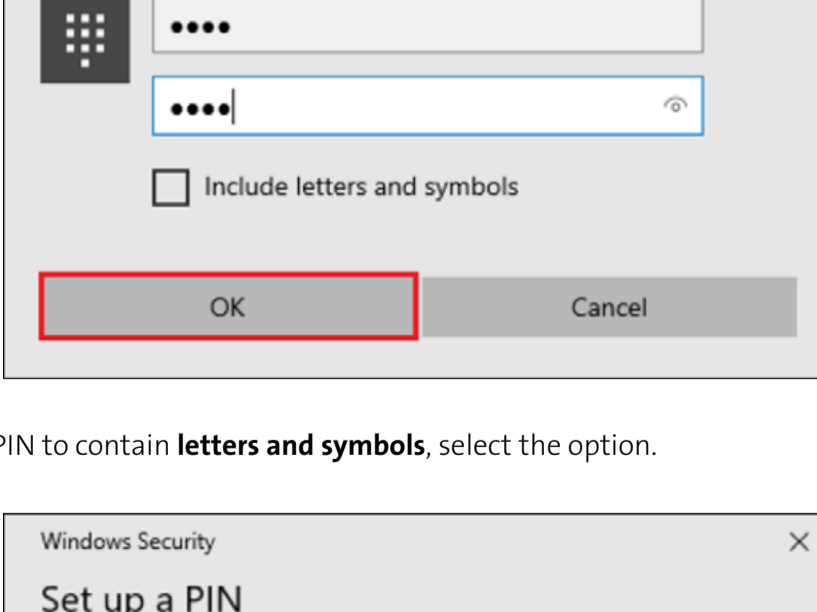

How to Remove your Fingerprint.

1. To remove finger print click **Remove** under Windows Hello Fingerprint options

